

Technical Bulletin

Model
911 Carrera

Group
8

Subject: Rear Heater Fan Modified

Part Identifier
8018

Number
9202

ATTENTION: Service Manager/Service Technician

Models Affected: *911 Carrera, model years 1984 (E) through 1989 (K)*

Concern: Replacement rear heater fan modified.

Repair Information: The replacement rear heater fan (new Part Number 965 624 151 00) has a repositioned wiring plug. When installing this new version heater fan in the 911 Carrera, model years 1984 (E) through 1989 (K), the fan motor must be repositioned in the fan housing.

Work Procedure: Remove the three fan motor mounting nuts (arrows in Figure 1). Reposition the motor 120° clockwise in the housing. Reinstall nuts and torque to 2.5 Nm (1.85 ft. lbs.).

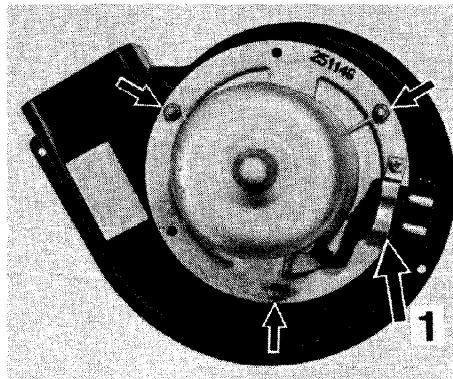


Figure 1 (new version shown)

Warranty Information:

Damage Code: 8018100001

Labor Operations:

80181900	R & R Warm Air Blower	60 Time Units
8018190A	Actual Time	20 Time Units

