

Technical Bulletin

Model
911 C2/C4
Turbo

Group
1

Subject:

Engine Cooling Fan Hub

Part Identifier
1905


Number
9306

ATTENTION: Service Manager / Service Technician

Models Affected: *911 Carrera 2/4 1989-on*
911 Turbo 1991-on

General Information: The engine cooling fan hub (with bearing) is now available as a separate part.

Repair Information: The hub can be removed and installed using a normal shop press. The hub should be used when a vehicle is being repaired for a noisy or damaged fan bearing or fan hub.

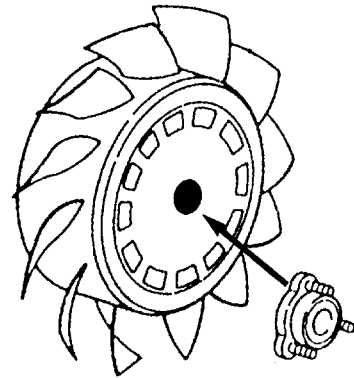

The fan hub can be installed on engine cooling fans with the following part numbers:

Description	Part Number
Cooling fan	964 106 015 02/20/30/75/76
Cooling fan	930 106 015 00

Parts Information: Engine cooling fan hub 964 106 051 30

Warranty Information: (If applicable) Damage Code: 1905 10 0002

Labor Operation:		911 C2/C4	Turbo
1905 1500	R+R Fan	70 TU	160 TU
1905 4950	R+R Fan Hub	20 TU	20 TU

P
O
R
S
C
H
E

C
A
R
S

N
O
R
T
H

A
M
E
R
I
C
A

I
N
C
.

