

# Technical Bulletin

Model  
6 Cyl.

Group  
2

Subject:

**Fuel Filler Pipe**

Part Identifier

**2007**

Number

**9401**

**ATTENTION: Service Manager / Service Technician**


**Models Affected:** *911 C2/C4 all  
911 Turbo 1991-on*

**Concern:** If a customer complaint of fuel odor is reported, first check all connections on the fuel tank, filler pipe and cap for tightness and proper sealing.

Pressurizing the fuel tank with approximately 3 PSI and using an electronic hydrocarbon detector will find very small leaks which may be possible on the top of the filler neck or on the hose connections. If the fuel filler pipe shows signs of leakage in these areas, it must be replaced.

**General Information:** If the fuel filler pipe is found to be leaking, only the fuel filler pipe with a metal band at the top should be used for repairs.

Parts Information:	Description	Part Number
	Fuel Filler Pipe	964 201 043 03

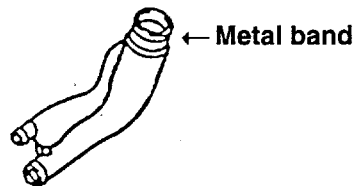

**Warranty Information:** (if applicable) Damage code: 2007 50 0002

Labor Operation	Description	
2007 1900	R&R Fuel filler pipe	30TU

