

Technical Bulletin

Model
911 C2
Tiptronic

Group
3

Subject: ATF Front Oil Cooler Line

Part Identifier
3862

Number
9205

ATTENTION: Service Manager/Service Technician

Important: The following information refers to repairs made when performing Service Action 092. See Technical Bulletin Group 3, Number 9204.

Models Affected: *All 911 C2 with Tiptronic transmission*

Concern: Correct installation of front lower panel mounting screws.

General Information: When installing the front lower panel on 911 C2 cars with Tiptronic transmission, the mounting screws (arrows, Figure 1) must be of the correct length. Failure to install the correct screws into the locations shown in Figure 1 can lead to damage of the transmission oil cooler line and Tiptronic transmission. After installing these four screws, mark the screw heads with a red paint dot.

Parts Information: Screw (Qty. 4) Part Number N 013 966 17

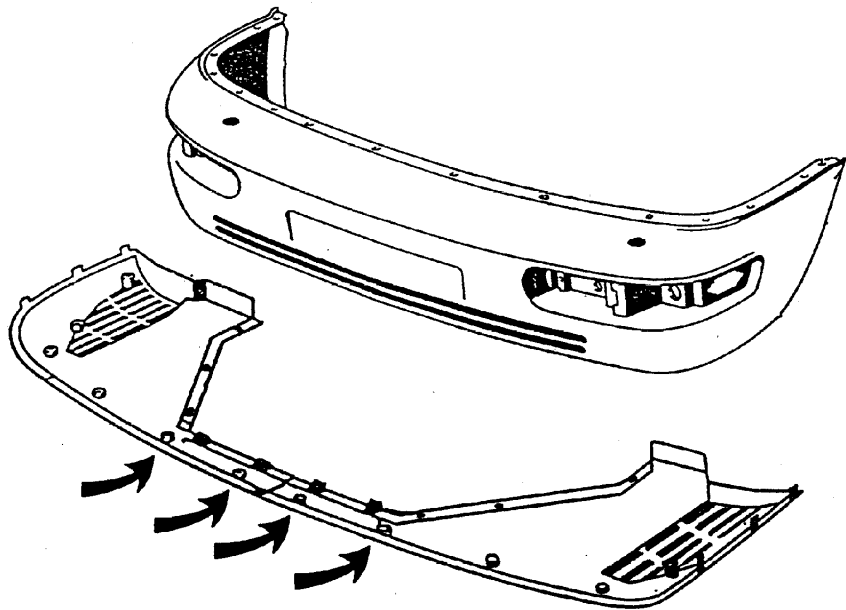


Figure 1

PORSCHE CARS NORTH AMERICA INC.

